

## Front Driver or Passenger Power Seat Adjust Functions Inoperative and/or Driver Seat Memory Inoperative (Check Power Seat Switch Connector)

### TECHNICAL SERVICE BULLETIN

Reference Number(s): 06-08-50-012, Date of Issue: October 06, 2006

Affected Model(s): 2007 Cadillac Escalade, Escalade ESV, Escalade EXT; 2007 Chevrolet Avalanche, Silverado (New Style), Suburban, Tahoe; 2007 GMC Sierra (New Style), Yukon, Yukon Denali, Yukon XL, Yukon Denali XL

Related Ref Number(s): 06-08-50-012

## ARTICLE BEGINNING

## CONDITION

Some customers may comment that the front driver or passenger power seat adjust functions are inoperative. They may also comment that the driver seat memory is inoperative.

## CAUSE

The cause of this condition may be due to the power seat switch connector not being fully seated.

## CORRECTION

### Correction

Do This	Don't Do This
Check that the power seat switch connector is fully seated.	Replace the power seat switch.

Remove the front seat cushion outer trim panel following the replacement procedure in SI. Verify that the power seat switch connector is fully seated. Reseat the connector and test the seat functions.

## WARRANTY INFORMATION

For vehicles repaired under warranty, use:

### Warranty Information

Labor Operation	Description	Labor Time
N6648	Wiring and/or Connector-Seat System - Repair	Use Published Labor Operation Time

© 2008 Mitchell Repair Information Co., LLC.